




XMS-1000

Gasdruckfeder



Grün
Blau
Rot
Gelb
Schwarz

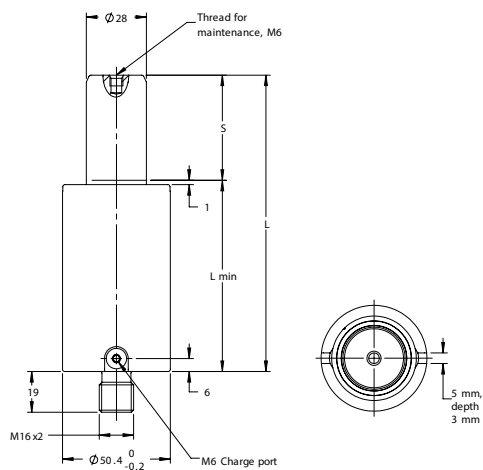


T: < 80 °C



S = Hub

S	L ± 0.25	L min	F1 [daN]	F2 [daN]	m [kg]	V [L]	Order No.
13	64	51	920	1380	0.50	0.030	XMS-1000-13
16	70	54	920	1380	0.52	0.040	XMS-1000-16
19	76	57	920	1400	0.54	0.040	XMS-1000-19
25	88	63	920	1420	0.59	0.050	XMS-1000-25
32	102	70	920	1430	0.64	0.060	XMS-1000-32
38	114	76	920	1450	0.70	0.070	XMS-1000-38
50	138	88	920	1460	0.79	0.090	XMS-1000-50
63	164	101	920	1470	0.89	0.11	XMS-1000-63
75	188	113	920	1470	0.99	0.13	XMS-1000-75
80	198	118	920	1480	1.03	0.14	XMS-1000-80
100	238	138	920	1480	1.19	0.17	XMS-1000-100
125	288	163	920	1480	1.39	0.21	XMS-1000-125

EINBAUVARIANTEN

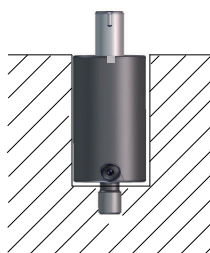

Druckmedium	N2
Max. Fülldruck (bei 20° C)	150 bar
Min. Fülldruck (bei 20° C)	25 bar
Betriebstemperatur	0° C - 80° C
Temperaturabhängige Druckerhöhung	0,3% / 1° C
Max. Kolbengeschwindigkeit	1,6 m/s
Empfohlene max Hübe / min (bei 20° C)	~ 15 - 40
Instandhaltungsset	3018847