


**MT-1000**

Gasdruckfeder High Temperature



Grün
Blau
Rot
Gelb
Schwarz

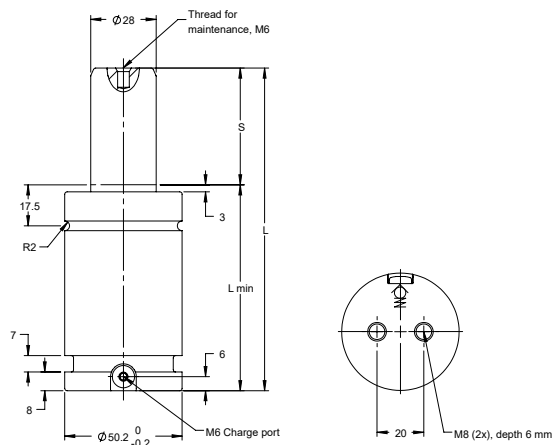


T: < 80 °C

 $S = \text{Hub}$

S	L ± 0.25	L min	F1 [daN]	F2 [daN]	m [kg]	V [L]	Order No.
13	64	51	920	1380	0.52	0.030	MT-1000-13
16	70	54	920	1380	0.54	0.040	MT-1000-16
19	76	57	920	1400	0.56	0.040	MT-1000-19
25	88	63	920	1420	0.61	0.050	MT-1000-25
32	102	70	920	1430	0.66	0.060	MT-1000-32
38	114	76	920	1450	0.71	0.070	MT-1000-38
50	138	88	920	1460	0.81	0.090	MT-1000-50
63	164	101	920	1470	0.91	0.11	MT-1000-63
75	188	113	920	1470	1.02	0.13	MT-1000-75
80	198	118	920	1480	1.05	0.14	MT-1000-80

EINBAUVARIANTEN

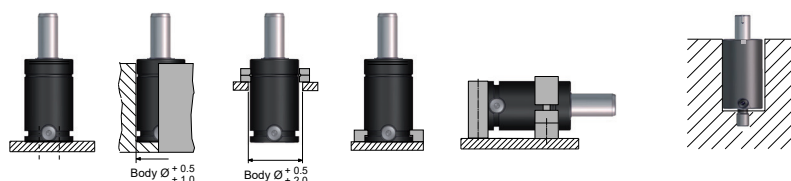

Druckmedium	N2
Max. Fülldruck (bei 20° C)	115 - 150 bar
Min. Fülldruck (bei 20° C)	25 bar
Betriebstemperatur	0° C - 120° C
Temperaturabhängige Druckerhöhung	0,3% / 1° C
Max. Kolbengeschwindigkeit	1,0 m/s
Empfohlene max Hübe / min (bei 20° C)	~ 10 - 20
Instandhaltungsset	3022690