



## CX-1900


Gasdruckfeder Compact Xtreme



Grün  
Blau  
Rot  
Gelb  
Schwarz




T: &lt; 80 °C

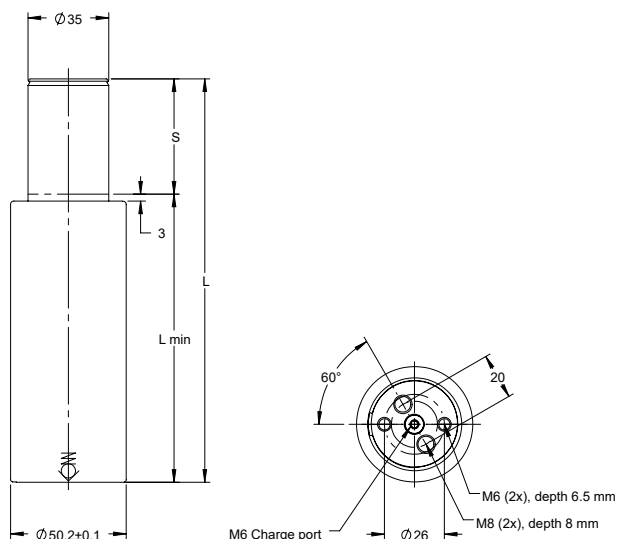

S = Hub

| S  | L ± 0.25 | L min | F1 [daN] | F2 [daN] | m [kg] | V [L] | Order No.  |
|----|----------|-------|----------|----------|--------|-------|------------|
| 10 | 80       | 70    | 1920     | 2630     | 0.69   | 0.050 | CX-1900-10 |
| 15 | 95       | 80    | 1920     | 3180     | 0.76   | 0.050 | CX-1900-15 |
| 25 | 115      | 90    | 1920     | 3090     | 0.84   | 0.080 | CX-1900-25 |
| 38 | 150      | 112   | 1920     | 3190     | 0.98   | 0.12  | CX-1900-38 |
| 50 | 175      | 125   | 1920     | 3380     | 1.08   | 0.14  | CX-1900-50 |
| 63 | 205      | 142   | 1920     | 3480     | 1.21   | 0.17  | CX-1900-63 |
| 80 | 245      | 165   | 1920     | 3560     | 1.37   | 0.21  | CX-1900-80 |

## EINBAUVARIANTEN

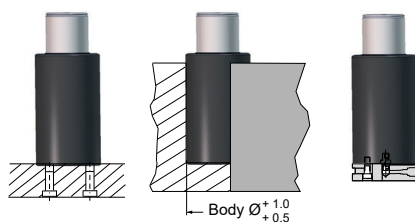

| Druckmedium                           | N2           |
|---------------------------------------|--------------|
| Max. Fülldruck (bei 20° C)            | 200 bar      |
| Min. Fülldruck (bei 20° C)            | 25 bar       |
| Betriebstemperatur                    | 0° C - 80° C |
| Temperaturabhängige Druckerhöhung     | 0,3% / 1° C  |
| Max. Kolbengeschwindigkeit            | 1,6 m/s      |
| Empfohlene max Hübe / min (bei 20° C) | ~ 50 - 130   |
| Instandhaltungsset                    | 23022844     |